


MI-600

ABS OR PVC "P-TRAP" TRAP SEAL PRIMER CONNECTOR

Specification: MIFAB® Series MI-6__ ABS or PVC (specify) schedule #40 D.W.V. P-trap trap seal primer connector, with 2" (51), 3" (76), or 4" (102) (specify) pipe connections, and a 1/2" (13) for 3/8" copper tube or 5/8" (16) for 1/2" copper tube (specify) brass compression fitting connection to attach to a trap seal primer water supply line. The MIFAB MI-600 Series of P-trap trap seal primer connectors meet the ASTM D-2661 and ASTM D-2665 Standards.

Function: Typically used as a trap seal primer connection underneath the outlet of a floor drain, area drain or floor sink. The top of the MI-600 product is either 2", 3" or 4" PVC or ABS socket connection so that it can match any 2", 3" or 4" PVC or ABS outlet floor drain or floor sink connection.

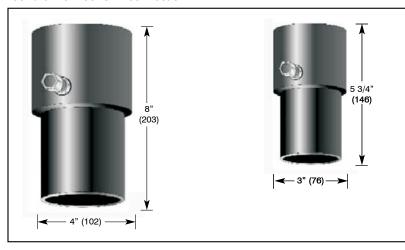


FEATURES:

- Can be rotated 360 degrees prior to cementing inside a standard p-trap in order to receive a water supply from any direction.
- Eliminates a no-hub tapped p-trap, 2 ABS no hub adaptors and 2 no hub couplings or PVC no-hub adaptors.
- No moving parts, simple installation and low cost
- Either a 1/2" (13) or 5/8" (16) brass compression fitting is supplied with each unit for either 3/8" copper tube or 1/2" copper tube connections.

NOTE:

1/2" connections for 3/8" copper tube. 5/8" connections for 1/2" copper tube.

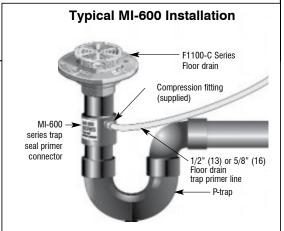

MODEL NO.	CONNECTION SIZE	COMPRESSION FITTING SIZE	MATERIAL TYPE	INDIVIDUAL WEIGHT (LBS.)	CARTON QUANTITY	CARTON WIGHT (LBS)
MI-602	2" (51)	1⁄2" (13)	ABS	.30	24	7.20
MI-603	3" (76)	1⁄2" (13)	ABS	.50	18	9.00
MI-604	4" (102)	1⁄2" (13)	ABS	.70	12	8.40
MI-612	2" (51)	5/8" (16)	ABS	.30	24	7.20
MI-613	3" (76)	5/8" (16)	ABS	.50	18	9.00
MI-614	4" (102)	5/8" (16)	ABS	.70	12	8.40
MI-622	2" (51)	1⁄2" (13)	PVC	.30	24	7.20
MI-623	3" (76)	1/2" (13)	PVC	.50	18	9.00
MI-624	4" (102)	1⁄2" (13)	PVC	.70	12	8.40
MI-632	2" (51)	5/8" (16)	PVC	.30	24	7.20
MI-633	3" (76)	5/8" (16)	PVC	.50	18	9.00
MI-634	4" (102)	5/8" (16)	PVC	.70	12	8.40

CALIFORNIA PROPOSITION 65 WARNING. This product contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm.

Job Name:	Page No:
Section No:	Contractor:
Schedule No:	Purchase Order No:



MI-600

ABS OR PVC "P-TRAP" TRAP SEAL PRIMER CONNECTOR

TRAP SEAL PRIMER TROUBLESHOOTING

Following are some things to trouble shoot when it comes to our M-500-NPB Series of Trap Seal Primers (M1-500-NPB, M2-500-NPB, MR-500-NPB).

- 1) What is the line pressure for the Installation?
 - The M-500-NPB Series will work in 35-80psi.
- 2) How far away is the trap seal primer from the source of the pressure drop? Anything farther away than 20 feet is an issue, as the farther the primer is away from the source of the pressure drop, the less likely it will sense it and work.
- What is the pressure drop where the primer is? MIFAB's M-500-NPB Series of primers will work with as little as 3 psi in pressure drop. With today's low flow and consumption faucets, there is less pressure drop being created when the faucets and toilets are used.
- 4) Water hammer arrestors on the line can also affect pressure drop in the line. It would be best to get a pressure reading where the trap primer is installed. The M-500-NPB series needs a fast, sharp pressure drop to activate. The long pipe run to the trap primer and the water hammer arrestor may not be allowing the trap primer to function properly.
- 5) Look at the gauge fluctuation

Is it a quick and sharp pressure drop? Or did it gradually drop? The trap primers need a quick pressure drop to activate. A slow gradual pressure drop may not be enough to activate the M-500-NPB. That is why we state that they should be as close to the pressure drop source as possible. The M1-500 has the most buoyant cartridge and should perform the best. If the trap primer looked good and was filled with water then it is the rate of the pressure drop that is causing the issue.

Also refer to the copy in the Trap Seal Primer section in the current MPB List Price book.

CALIFORNIA PROPOSITION 65 WARNING. This product contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm.			
Job Name:	Page No:		
Section No:	Contractor:		
Schedule No:	Purchase Order No:		